
Walker Fraser Steele Chartered Surveyors

91 ST MUNGOS ROAD CUMBERNAULD GLASGOW G67 1BF



Energy Performance Certificate (EPC)

Dwellings

Scotland

91 ST MUNGO'S ROAD, TOWN CENTRE, GLASGOW, G67 1BF

Dwelling type: Mid-floor flat
Date of assessment: 02 November 2023
Date of certificate: 02 November 2023

Total floor area: 69 m²

Primary Energy Indicator: 136 kWh/m²/year

Reference number: 0923-1915-7209-7437-3204 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: ECMK

Main heating and fuel: Boiler and radiators, mains


gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,862	See your recommendations
Over 3 years you could save*	£474	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

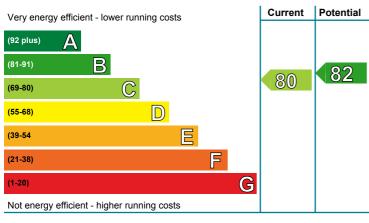


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (80)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

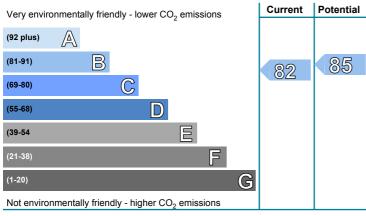

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (82)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Low energy lighting	£15	£84.00
2 Condensing boiler	£2,200 - £3,000	£387.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	****	****
Roof	(another dwelling above)	_	_
Floor	(another dwelling below)	_	_
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 73% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 24 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.6 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

L-CE vv94.0.1.1 (SAP 9.94) Page 1 of 5

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,494 over 3 years	£1,284 over 3 years	
Hot water	£891 over 3 years	£729 over 3 years	You could
Lighting	£477 over 3 years	£375 over 3 years	save £474
Totals	£2,862	£2,388	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


December 1 and management		Indiantive and	Typical saving	Rating after i	mprovement
Re	commended measures	Indicative cost	per year	Energy	Environment
1	Low energy lighting for all fixed outlets	£15	£28	C 80	B 83
2	Replace boiler with new condensing boiler	£2,200 - £3,000	£129	B 82	B 85

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump
- Micro CHP

Choosing the right improvement package





About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

2 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	2,420	N/A	N/A	N/A
Water heating (kWh per year)	1,988			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK (www.ecmk.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Alan Hudson Assessor membership number: ECMK302881

Company name/trading name: Walker Fraser Steele

Address: 27

WATERLOO STREET

GLASGOW G2 6BZ

Phone number: 07801301462

Email address: alan.hudson@walkerfrasersteele.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.


Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





survey report on:

Property address	91 ST MUNGO'S ROAD Town Centre Glasgow G67 1BF
Customer	Mr S J & Mrs J E Legg
Customer address	
Prepared by	Walker Fraser Steele
Date of inspection	2nd November 2023

Walker Fraser Steele Chartered Surveyors

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report ² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a self-contained flat located on the first floor of a 4 storey & basement flatted block.
Accommodation	Entrance Hall, Living Room with Open-Plan Kitchen, Two Bedrooms, Bathroom and an En-Suite Shower Room.
Gross internal floor area (m²)	69 sq.m.
Neighbourhood and location	The subjects form part of a relatively modern flatted development close to Cumbernauld Town Centre. Other properties in the development are of a similar age and style. There is a good range of residential amenities available in the local area. Public transport is readily available.
Age	The property is estimated to be approximately 15 years old.
Weather	At the time of our inspection, it was dry.
Chimney stacks	Not applicable.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. The roof is of a pitched design and is overlaid with concrete tiles. due to the height of the building at the rear and the configuration of the site, it has not been possible to inspect the rear roof slope and we are therefore unable to confirm its condition. The communal roof space has not been inspected.

appropriate. Gutters and downpipes are formed with plastic fittings. Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The outer walls are of modern timber framed construction generally clad externally with facing brick. The upper level of the building has been rendered externally. Outer walls are lined internally with plasterboard. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stainwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable		
Main walls Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The outer walls are of modern timber framed construction generally clad externally with facing brick. The upper level of the building has been rendered externally. Outer walls are lined internally with plasterboard. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stainvell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	Rainwater fittings	
appropriate. Foundations and concealed parts were not exposed or inspected. The outer walls are of modern timber framed construction generally clad externally with facing brick. The upper level of the building has been rendered externally. Outer walls are lined internally with plasterboard. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stainwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		Gutters and downpipes are formed with plastic fittings.
appropriate. Foundations and concealed parts were not exposed or inspected. The outer walls are of modern timber framed construction generally clad externally with facing brick. The upper level of the building has been rendered externally. Outer walls are lined internally with plasterboard. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stainwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	[[
inspected. The outer walls are of modern timber framed construction generally clad externally with facing brick. The upper level of the building has been rendered externally. Outer walls are lined internally with plasterboard. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	Main walls	
clad externally with facing brick. The upper level of the building has been rendered externally. Outer walls are lined internally with plasterboard. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Communal areas Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		
keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		clad externally with facing brick. The upper level of the building has been rendered externally. Outer walls are lined internally with
keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	[
Doors and windows were not forced open. Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	Windows, external doors and joinery	
Windows are formed with uPVC framed double glazed units. The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		Random windows were opened and closed where possible.
The door into the property comprises a single leaf timber unit. Plastic soffits and fascias are in place around eaves level. External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		Doors and windows were not forced open.
Plastic soffits and fascias are in place around eaves level. Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		Windows are formed with uPVC framed double glazed units.
External decorations Not applicable. Conservatories / porches Not applicable. Circulation areas visually inspected. There is a common entrance/lift lobby and a stainwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		The door into the property comprises a single leaf timber unit.
Conservatories / porches Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Visually inspected. Not applicable Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		Plastic soffits and fascias are in place around eaves level.
Communal areas Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	External decorations	Not applicable.
Communal areas Circulation areas visually inspected. There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Garages and permanent outbuildings Visually inspected. Not applicable Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		
There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Wisually inspected. Not applicable Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	Conservatories / porches	Not applicable.
There is a common entrance/lift lobby and a stairwell providing access to all levels of the building. Visually inspected. Not applicable Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	Communal areas	Circulation areas visually inspected.
Garages and permanent outbuildings Visually inspected. Not applicable Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		
Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		
Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		1
Outside areas and boundaries Visually inspected. There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	Garages and permanent outbuildings	Visually inspected.
There are communal garden areas throughout the development. These areas are generally laid to lawn. There is residents car parking spaces located to the front of the		Not applicable
These areas are generally laid to lawn. There is residents car parking spaces located to the front of the	Outside areas and boundaries	Visually inspected.

Ceilings	Visually inspected from floor level.
	Ceilings are formed in plasterboard.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Partitions are of stud framed construction, lined with plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Floors are of suspended timber construction over a suspended concrete platform. Our inspection of floor surfaces has been restricted by the presence of floor coverings and furnishings throughout.
	It has not been possible to inspect the sub-floor area.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	There is a range of doors, door facings and skirting boards throughout.
	The kitchen contains a range of wall mounted and base units.
Chimney breasts and fireplaces	Not applicable.
Internal decorations	Visually inspected.
	Internal surfaces have been painted. Ceramic tiles have also been utilised.
Cellars	Not applicable.
Condito	Tot applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply.
	The electricity meter and consumer unit are located in one of the hall cupboards.

Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains supply.
	The gas meter is located in the kitchen.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Mains supply
	Visible pipework is formed with copper and plastic fittings.
	The bathroom contains a suite comprising; bath with mixer shower attachment, wash hand basin and a WC.
	The en-suite shower room contains a suite comprising; shower cubicle with electric shower attachment, wash hand basin and a WC.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	There is a gas fired central heating incorporating water filled radiators. The boiler is located in the kitchen and is vented by means of a fan-assisted flue.
	Hot water is also supplied by the central heating boiler.
Drainage	Drainage covers etc. were not lifted.
	Neither drains nor drainage systems were tested.
	It is assumed that the drains are connected to the public sewer.
Fire, smoke and burglar alarms	Visually inspected.
,	No tests whatsoever were carried out to the system or
	appliances.
	For both new and existing homes, from February 2022 The Fire and

91 ST MUNGO'S ROAD, Town Centre, Glasgow, G67 1BF 2nd November 2023 ES-5535278 Smoke Alarm Standard requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner a carbon monoxide detector is

also required. You can obtain further details from the Scottish Government web site www.mygov.scot (search Smoke Alarm).

We note that smoke detectors, a heat alarm and carbon monoxide detectors have been installed.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.


If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

At the time of our inspection, the property was only part furnished and floor coverings were in place throughout.

It has not been possible to inspect the rear roof slope due to the configuration of the site.

Sectional Diagram showing elements of a typical house

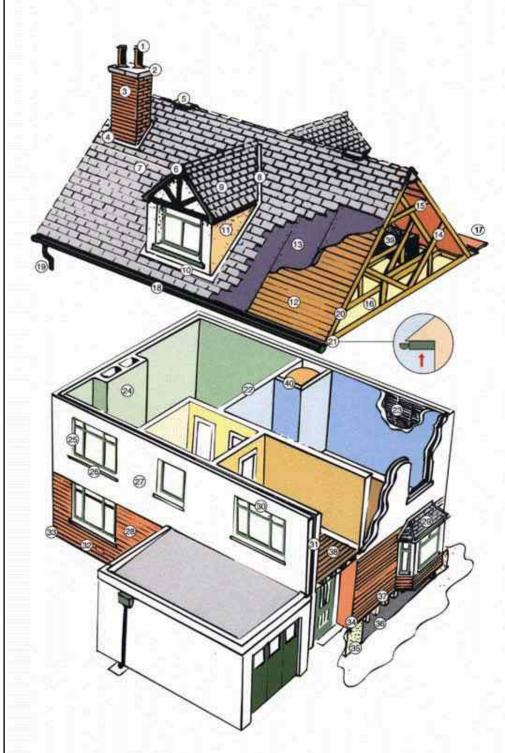

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- (2) Coping stone
- 3) Chimney head
- 4) Flashing
- 5 Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- (8) Valley guttering
- 9) Dormer projection
- 10 Dormer flashing
- (11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- (16) Insulation
- 7) Parapet gutter
- 8) Eaves guttering
- 19) Rainwater downpipe
- 0) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- Latin / plaster
- (24) Chimney breast
- 25) Window pointing
- 26) Window sills
- (27) Rendering
- 28) Brickwork / pointing
- 29 Bay window projection
- (30) Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
	Repairs or replacement requiring future attention, but estimates are still advised.	

Structural movement	
Repair category	1
Notes	No obvious evidence of structural movement was noted.

Dampness, rot and infestation	
Repair category	1
Notes	There is no evidence indicating any significant dampness, rot or infestation within the limitations and scope of the inspection and report.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1
Notes	Visible roof tiles are noted to be in acceptable condition.

Rainwater fittings	
Repair category	1
Notes	No obvious defects to report.

Main walls	
Repair category	1
Notes	The outer walls are generally in a condition that is consistent with age and type of construction. No obvious issues.

Windows, external doors and joinery	
Repair category	1
Notes	Double glazed window units are noted to be in acceptable condition.
	The entrance door is in satisfactory condition.

External decorations	
Repair category	-
Notes	Not applicable.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	1
Notes	The communal areas within the building and the exterior parts of the development are noted to have been adequately maintained.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	1
Notes	Garden areas and the residents car park have been adequately maintained.

Ceilings	
Repair category	1
Notes	No obvious defects to report.

Internal walls	
Repair category	1
Notes	No obvious issues.

Floors including sub-floors	
Repair category	1
Notes	Floors are noted to be reasonably level and even.

Internal joinery and kitchen fittings	
Repair category	1
Notes	There are no obvious issues noted to be affecting the joinery fittings.
	Kitchen units appear to be original and are affected by wear and tear consistent with normal use.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	1
Notes	The standard of internal decorations is good.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	1
Notes	It should be noted that the electrical installation has not been tested as this is outside the remit of this inspection. However, it would be prudent to follow guidance set out by the Institute of Electrical Engineers advising that a domestic electrical installation should undergo a safety test every 5 years or at a change of ownership.

Gas	
Repair category	1
Notes	There has been no test of the gas installation as this is not in our remit for this type of inspection. No obvious issues have been noted but it would be prudent to arrange for a gas safety test to be carried out in early course and then yearly thereafter.

Water, plumbing and bathroom fittings			
Repair category	1		
Notes	There are no obvious issues noted to be affecting visible plumbing apparatus.		
	Sanitaryware is generally in acceptable condition although some fittings are affected by some wear and tear consistent with normal use		

Heating and hot water				
Repair category	1			
Notes	The central heating system has not been tested as this is outside the scope of this inspection. Heating and hot water systems should be serviced annually by an appropriately			
	qualified contractor to ensure the system remain safe and fully functional.			

Drainage	
Repair category	1
Notes	There are no obvious issues noted that relate to the foul or surface water drainage systems.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	-
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	First
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes X No
4. Are all door openings greater than 750mm?	Yes X No
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property is assumed to be held in 'Absolute Ownership' and unaffected by any onerous burdens or title restrictions.

Where items of maintenance or repair have been identified, the purchaser should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

It is assumed that the roads and footpaths bounding the property have been adopted and are maintained by the Local Authority.

Estimated reinstatement cost for insurance purposes

£165,000 (One Hundred and Sixty Five Thousand Pounds)

Valuation and market comments

£130,000 (One Hundred and Thirty Thousand Pounds)

The valuation reflects the current condition of the property. Prevailing market conditions in the local area have also been considered.

Signed	Security Print Code [377613 = 9364] Electronically signed
Report author	Alan Hudson
Company name	Walker Fraser Steele
Address	1st Floor, Cadell House, 23-31 Waterloo Street, Glasgow, G2 6BZ
Date of report	2nd November 2023

Walker Fraser Steele Chartered Surveyors

Property Address	
Address Seller's Name Date of Inspection	91 ST MUNGO'S ROAD, Town Centre, Glasgow, G67 1BF Mr S J & Mrs J E Legg 2nd November 2023
Property Details	
Property Type	House Bungalow Purpose built maisonette Converted maisonette X Purpose built flat Converted flat Tenement flat Flat over non-residential use Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block ▼ Low rise block □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, X Yes No nilitary, police?
Flats/Maisonettes onl Approximate Year of	No. of units in block 14
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 2 Bedroom(s) 1 Kitchen(s) 2 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)
	cluding garages and outbuildings) 69 m² (Internal) 79 m² (External)
Residential Element ((greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?	□ Double garage ▼ Parking space □ No garage / garage space / parking space ▼ Yes No
Permanent outbuildin	ngs:
None.	

Construction							
Walls	Brick	Stone	Concrete	X Timber frame	Othe	er (specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	Othe	er (specify in Gen	eral Remarks)
Special Risks							
Has the property s	suffered struct	ural movemen	t?			Yes	X No
If Yes, is this rece	nt or progress	ive?				Yes	No
Is there evidence, immediate vicinity	•	ason to anticipa	ate subsidence	heave, landslip o	or flood in the	e Yes	X No
If Yes to any of the	e above, provi	de details in G	eneral Remark	S.			
Service Connec	tions						
Based on visual in of the supply in Go			es appear to be	non-mains, pleas	se comment	on the type a	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description o	f Central Hea	ting:					
Gas fired boiler s	supplying wate	er filled radiato	rs.				
Site							
Apparent legal iss	ues to be veri	fied by the con	veyancer. Plea	ase provide a brie	f description	in General R	temarks.
Rights of way	X Shared drive	es / access	Garage or other	amenities on separate	site Sha	ared service conn	ections
Ill-defined boundar	ies	Agricultur	al land included wit	h property	Oth	er (specify in Ge	neral Remarks)
Location							
Residential suburb	X Res	idential within tow	n / city Mixe	d residential / comme	rcial Mai	nly commercial	
Commuter village	Ren	note village	Isola	ted rural property	Oth	er (specify in Ge	neral Remarks)
Planning Issues	;						
Has the property been extended / converted / altered? Yes X No							
If Yes provide deta	ails in Genera	l Remarks.					
Roads							
Made up road	Unmade road	Partly co	empleted new road	Pedestrian a	ccess only	X Adopted	Unadopted

General Remarks
The subjects comprise a self-contained flat located on the first floor of a 4 storey & basement flatted block.
The subjects form part of a relatively modern flatted development close to Cumbernauld Town Centre. Other properties in the development are of a similar age and style.
The property has generally been adequately maintained having regard to its age and type of construction. There are some relatively minor items that require a degree of maintenance, but these can be attended to as part of a normal cyclical maintenance program.
Essential Repairs
None.
Estimated cost of essential repairs £ Retention recommended?Yes No Amount £

Comment on Mortgageability					
In our opinion the subjects	s would form suitable mortgage security by a lending institution.				
Valuations					
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary?					
Buy To Let Cases					
month Short Assured Tenai	ge of monthly rental income for the property assuming a letting on a 6 ncy basis? There there is a steady demand for rented accommodation of this type?	£ Yes No			
Declaration					
Signed Surveyor's name	Security Print Code [377613 = 9364] Electronically signed by:- Alan Hudson				
Professional qualifications	MRICS				
Company name	Walker Fraser Steele				
Address	1st Floor, Cadell House, 23-31 Waterloo Street, Glasgow, G2 6BZ				
Telephone	0141 221 0442				
Fax	0141 258 5976				
Report date	2nd November 2023				



Property address	91 ST MUNGO'S ROAD, CUMBERNAULD, GLASGOW, G67 1BF
Seller(s)	Mr S J & Mrs J E Legg
Completion date of property questionnaire	07/11/2023

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer
 each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell
 your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership				
	How long have you owned the property? 13 Years - From New Build				
2.	Council tax				
	Which Council Tax band is your property in? (Please circle)				
	A B C D E F G H				
3.	Parking				
	What are the arrangements for parking at your property?				
	(Please tick all that apply)				
	• Garage				
	Allocated parking space				
	Driveway				
	Shared parking				
	On street				
	Resident permit				
	Metered parking				
	Other (please specify): Resident's Parking				
4.	Conservation area				
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?				

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? If you have answered yes, please describe below the changes which you have made:	Yes / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes / Ne
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes / No
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes / No
	(ii) Did this work involve any changes to the window or door openings?	Yes / No
	(iii) Please describe the changes made to the windows, doors or patio doors (vidates when the work was completed):	vith approximate
	Please give any guarantees which you received for this work to your solicitor or e	estate agent.

7.	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	Yes / Ne / Partial
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	Gas Fired	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	13 years ago from new build
c.	Do you have a maintenance contract for the central heating system?	Yes / No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yos / No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yos / No
b.	Are you aware of the existence of asbestos in your property?	Yes / No
	If you have answered yes, please give details:	

10.	Services						
a.	Please tick which services are connected to your property and give details of the supplier:						
		Services	Connected	Supplier			
		Gas / liquid petroleum gas	✓	E-On Energy			
		Water mains / private water supply	✓	Scottish Water			
		Electricity	✓	E-On Energy			
		Mains drainage	✓	Scottish Water			
		Telephone					
		Cable TV / satellite					
		Broadband					
b.		e a septic tank system at you		estions below:	Yos / No		
C.	(i) Do y	ou have appropriate conse	nts for the discha	rge from your septic tank?	Yes / No / Den't knew		
d.	(ii) Do y	you have a maintenance co	ntract for your sep	otic tank?	Yes / No		
	If you I have a	nave answered yes, please maintenance contract:	give details of the	ne company with which you			

anything used y, or garden	Yes / Ne / Don't Know
1	
ce of the roof,	Yes / No / Not applicable
he roof during	Yos / No
property - for es?	Yos / No
	Yos / No
	Yes / No
1	
	Yes / No
ess, and give	
g insurance.	
	property - for es? Int to walk over ain their The part of your has a right to ginsurance.

b.	Is there a common buildings insurance policy?	Yes / No / Don't Know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / No / Don't Know
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes / No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yos / No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	No	¥es	Don't know	With title doods	Lost	Cannot Answor*
(iii)	Central heating	No	Yos	Den't know	With title doods	Lost	Cannot Answor*
(iv)	NHBC	No	Yos	Don't know	With title doods	Lost	Cannot Answor*
(v)	Damp course	No	¥es	Don't know	With title doods	Lest	Cannot Answor*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas te(s):	se give de	etails of t	he work		
c.	Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details:					Yes / No	
15.	Boundaries						
	So far as you are aware, has any boundary o last 10 years? If you have answered yes, please give details		operty be	een move	ed in the	Yes Don'	/ No / Lknow

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Den't know
b.	that affects your property in some other way?	Yes / No / Don't know
C.	that requires you to do any maintenance, repairs or improvements to your property?	Yes / No / Den't knew
	If you have answered yes to any of a-c above, please give the notices to your so agent, including any notices which arrive at any time before the date of entry of t your property.	olicitor or estate he purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
·			
Date:			











