

# Home Report

FLAT 0/1  
87 DIXON AVENUE  
GLASGOW  
G42 8EP



**Walker Fraser Steele  
Chartered Surveyors**

# Energy Performance Certificate



# Energy Performance Certificate (EPC)

# Scotland

Dwellings

FLAT 0/1, 87 DIXON AVENUE, GLASGOW, G42 8EP

**Dwelling type:** Ground-floor flat  
**Date of assessment:** 10 February 2026  
**Date of certificate:** 10 February 2026  
**Total floor area:** 65 m<sup>2</sup>  
**Primary Energy Indicator:** 240 kWh/m<sup>2</sup>/year

**Reference number:** 0190-2410-7120-2496-5805  
**Type of assessment:** RdSAP, existing dwelling  
**Approved Organisation:** ECMK  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years\*

£3,309


See your recommendations report for more information

Over 3 years you could save\*

£813

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

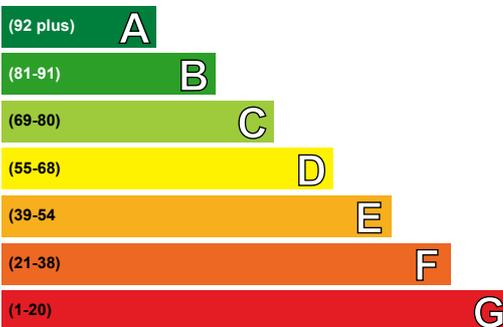

Current	Potential
66	73

## Energy Efficiency Rating


This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (66)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Not energy efficient - higher running costs

Very environmentally friendly - lower CO<sub>2</sub> emissions

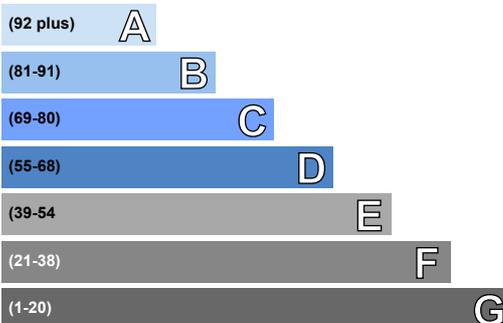

Current	Potential
65	75

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (65)**

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Not environmentally friendly - higher CO<sub>2</sub> emissions

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£900 - £1,500	£252.00
2 Internal wall insulation	£7,500 - £11,000	£183.00
3 Floor insulation (suspended floor)	£5,000 - £10,000	£309.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](http://greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	(another dwelling above)	—	—
Floor	Suspended, no insulation (assumed)	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Below average lighting efficiency	★★☆☆☆	★★☆☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 44 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.9 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,559 over 3 years	£1,824 over 3 years	
Hot water	£507 over 3 years	£510 over 3 years	
Lighting	£243 over 3 years	£162 over 3 years	
<b>Totals</b>	<b>£3,309</b>	<b>£2,496</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Cavity wall insulation	£900 - £1,500	£84		
2 Internal wall insulation	£7,500 - £11,000	£61		
3 Floor insulation (suspended floor)	£5,000 - £10,000	£103		
4 Low energy lighting for all fixed outlets	£60 - £70	£24		

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- External insulation with cavity wall insulation

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 2 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association ([www.nationalinsulationassociation.org.uk](http://www.nationalinsulationassociation.org.uk)).

### 3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including [www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation](http://www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

### 4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	9,125.37	N/A	N/A	N/A
Water heating (kWh per year)	2,184.88			

## Addendum

This dwelling may be exposed to wind driven rain and so requires further investigation to determine which type of cavity wall insulation is best suited.

## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK ([www.ecmk.co.uk](http://www.ecmk.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Alan Hudson
Assessor membership number:	ECMK302881
Company name/trading name:	Walker Fraser Steele
Address:	27 WATERLOO STREET GLASGOW G2 6BZ
Phone number:	07801301462
Email address:	<a href="mailto:alan.hudson@walkerfrasersteele.co.uk">alan.hudson@walkerfrasersteele.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

## Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk), with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at [www.gov.scot/epc](http://www.gov.scot/epc).

## Advice and support to improve this property


There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

**HOMEENERGYSCOTLAND.ORG**  
**0808 808 2282**  
FUNDED BY THE SCOTTISH GOVERNMENT



# Single Survey

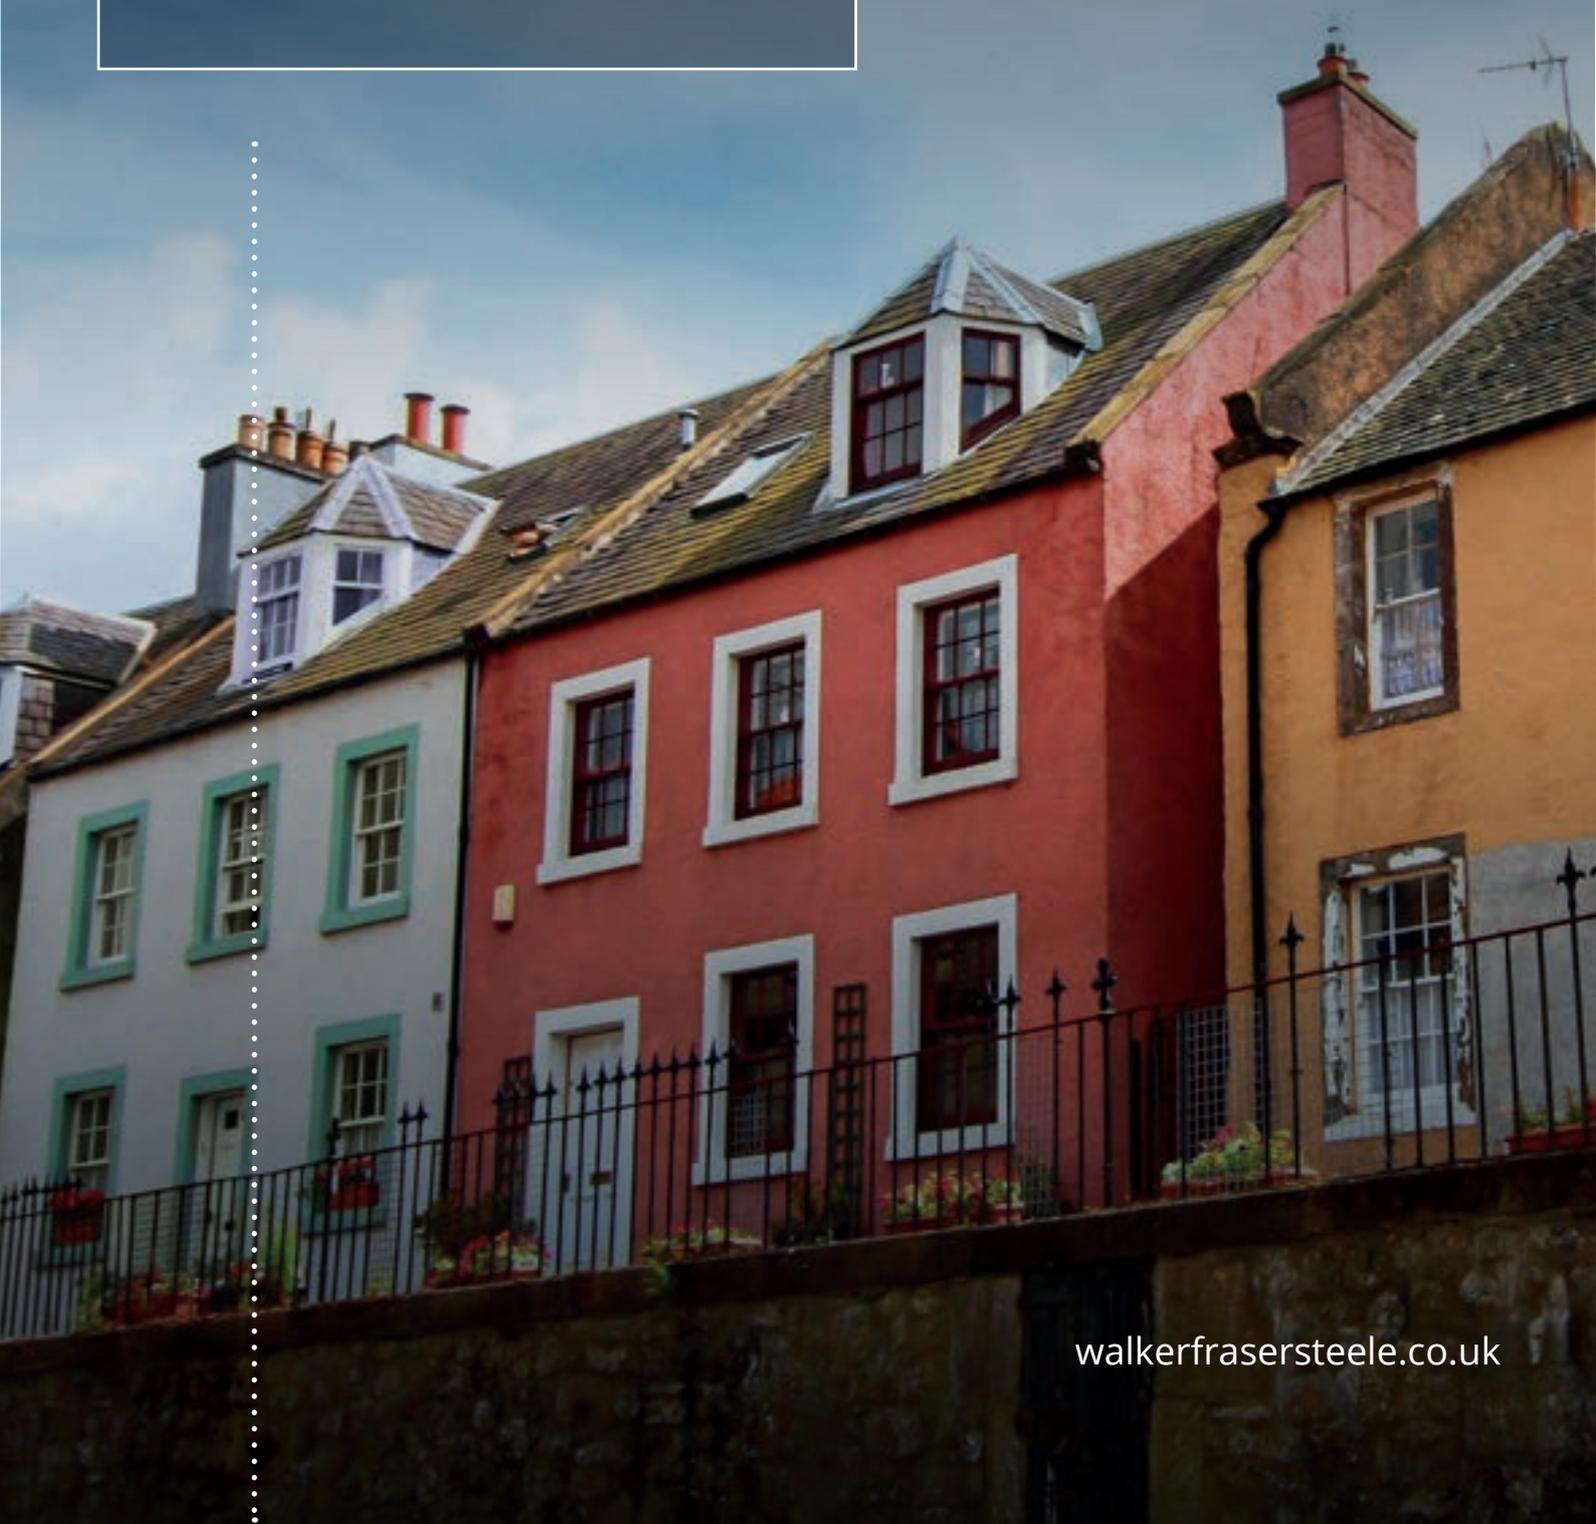

# Single Survey

<b>Property Address</b>	Flat 0/1 87 Dixon Avenue Glasgow G42 8EP
<b>Customer</b>	Nageen Khan
<b>Date of Inspection</b>	10/02/2026
<b>Prepared by</b>	Alan Hudson Walker Fraser Steele

## TERMS AND CONDITIONS

### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who will have sufficient current local knowledge of the particular market to competently survey, value and report upon Residential Property.<sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by checking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## **1.3 LIABILITY**

The Report is prepared with the skill and care reasonably to be expected of a competent residential Surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## **1.4 GENERIC MORTGAGE VALUATION REPORT**

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## **1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES**

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

## **1.6 INTELLECTUAL PROPERTY**

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## **1.7 PAYMENT**

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## **1.8 CANCELLATION**

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as

detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

<sup>1</sup>Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

<sup>2</sup>Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

## PART 2 – DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

**WARNING:** If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is

made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

<b>Description</b>	The subject property comprises a purpose built flat located on the ground floor of a 2 storey tenement style block
<b>Accommodation</b>	Entrance Hall, Living Room, Two Bedrooms, Kitchen and Shower Room.
<b>Gross internal floor area (sqm)</b>	65 sq.m.
<b>Neighbourhood and location</b>	The property is located in the Crosshill area of Glasgow, several miles to the South of the City centre. This is an established residential area originally and the block containing the subject property and several neighbouring blocks were constructed for Local Authority tenant accommodation. A number of properties have now passed into private ownership. There is a variety of property types in the local area including traditional 4 storey tenement blocks and terraced houses/flats. There is a wide range of residential amenities available in the local area. There are good road and rail connections linking with the City Centre.
<b>Age</b>	It is estimated that the subject property was built in about 1930
<b>Weather</b>	At the time of the inspection, it was raining.
<b>Chimney stacks</b>	<b>Visually inspected with the aid of binoculars where required.</b>  Visible chimney stacks are of brick construction and incorporate lead flashings.

<b>Roofing including roof space</b>	<p><b>Sloping roofs were visually inspected with the aid of binoculars where required.</b></p> <p><b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defines as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</b></p> <p><b>Roofs are prone to water penetration in extreme storms but it is not always possible for surveyors to identify this likelihood in good or dry weather. All slated roofs in particular should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.</b></p> <p>The roof is pitched and covered with concrete tiles. Part of the front roof slope is hidden behind a parapet wall feature above the bay window projection.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where required.</b></p> <p>Rainwater conductors are formed with a mix of cast-iron and plastic fittings.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where required.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>The outer walls are of cavity masonry construction with a sandstone facing to the front elevation, all plastered on the hard internally.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible. Doors and windows were not forced open.</b></p> <p>Windows are formed with uPVC framed double glazed units.</p> <p>The entrance door to the property comprises a single leaf timber door unit. There are also single leaf timber door units providing access to the building at the front and rear elevations.</p> <p>There are timber soffits and fascias at eaves level to the front and rear.</p>
<b>External decorations</b>	<p><b>Visually inspected</b></p> <p>Externally, cast-iron and timber components are painted.</p>


<b>Conservatories / porches</b>	None
<b>Communal areas</b>	The building contains a communal stairwell/close that provides access to all levels of the building and through to the communal garden/drying area at the rear.
<b>Garages and permanent outbuildings</b>	None
<b>Outside areas and boundaries</b>	<p>There is a private garden located to the front of the building directly in front of the subject property. This area is laid to lawn and is bounded by hedging.</p> <p>There is a communal drying green located at the rear of the building. The boundaries to the rear are formed with metal railings.</p> <p>There is a bin shelter located towards the rear of the ot that has been constructed in timber.</p>
<b>Ceilings</b>	<p><b>Visually inspected from floor level</b></p> <p>The ceilings generally appear to be formed in plasterboard that has been painted. However, the ceiling at the kitchen is of suspended concrete construction.</p>
<b>Internal walls</b>	<p><b>Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b></p> <p>Internal walls are of solid construction with a painted finish.</p>

<b>Floors including sub floors</b>	<p><b>Surface of exposed floors were visually inspected. No carpets or floor covering were lifted.</b></p> <p><b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted “head and shoulders” inspection at the access point.</b></p> <p><b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b></p> <p>The floors are of suspended concrete and suspended timber construction. Our inspection of floor surfaces has been limited by the presence of floor coverings throughout.</p> <p>It has not been possible to inspect the sub-floor area.</p>
<b>Internal joinery and kitchen fittings</b>	<p><b>Built-in cupboards were looked into but no stored items were moved.</b></p> <p><b>Kitchen units were visually inspected excluding appliances.</b></p> <p>There is a range of doors, door facings and skirting boards throughout.</p> <p>The kitchen contains a range of wall mounted and base units.</p>
<b>Chimney breasts and fireplaces</b>	<p><b>Visually inspected. No testing of the flues or fittings was carried out.</b></p> <p>There are chimney breasts present in the living room and rear bedroom. The original fireplaces have been removed although a gas fire has been installed in the rear bedroom.</p>
<b>Internal decorations</b>	<p><b>Visually inspected</b></p> <p>Internal surfaces have been painted. Wall paper and ceramic tiles have also been utilised.</p>
<b>Cellars</b>	None

<b>Electricity</b>	<p><b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</b></p> <p>Mains electricity is connected with the meter and consumer unit located in the entrance hall.</p>
<b>Gas</b>	<p><b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</b></p> <p>Mains gas supply is connected with a meter located in the kitchen.</p>
<b>Water, plumbing and bathroom fittings</b>	<p><b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Mains water supply is connected. Visible pipework is formed with plastic and copper fittings.</p> <p>The shower room contains a sanitary suite comprising; shower cubicle with mixer shower attachment, wash hand basin and a WC.</p>
<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There is a gas fired central heating system that incorporates water filled radiators. The boiler is located in the kitchen and is vented by means of a fan assisted flue.</p> <p>Hot water is provided by the central heating boiler.</p>
<b>Drainage</b>	<p><b>Drainage covers etc were not lifted. Neither drains nor drainage system were tested.</b></p> <p>Drainage is assumed to connect into the public sewer.</p>

<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>There are smoke alarms located in the entrance hall and living room.</p> <p>There are heat detectors located in the kitchen.</p> <p>No comment will be made on burglar alarm systems for security reasons.</p> <p>There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required.</p> <p>The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022.</p> <p>We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor.</p>
<b>Any additional limits to inspection</b>	<p>When visually inspected the property insulation was not disturbed, furniture and personal effects (particularly in cupboards) and floor coverings have not been moved.</p> <p>At the time of inspection, the property was unoccupied, but floors are fully covered and there are furnishings in a couple of the rooms.</p> <p>The sub-floor area and communal loft areas have not been inspected.</p>

## Sectional Diagram showing elements of a typical house

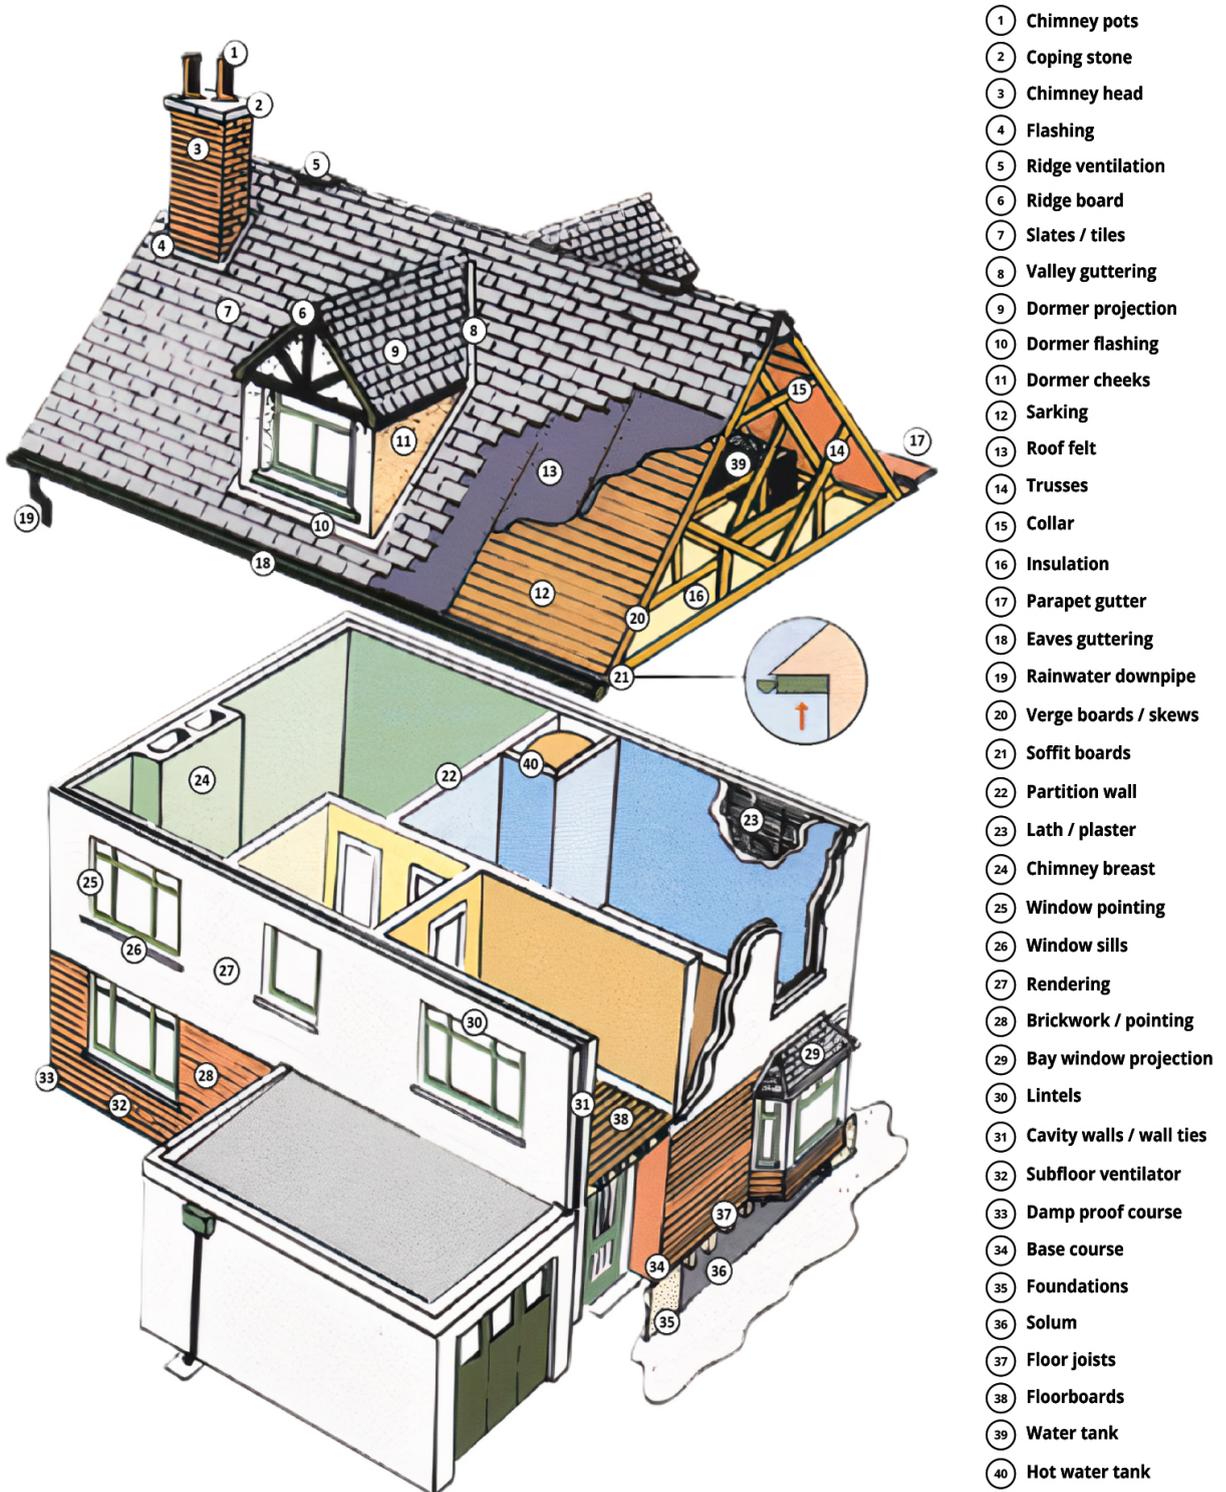

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

## 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 1 <span style="float: right;">1</span>	Category 2 <span style="float: right;">2</span>	Category 3 <span style="float: right;">3</span>
No immediate action or repair is needed.	Repairs or replacement requiring future attention, but estimates are still advised.	Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Structural movement	
<b>Repair category:</b>	1
<b>Notes</b>	Evidence of movement was observed in the form of hairline cracking to external masonry. This appears to be a minor defect which is not thought to have any serious structural significance.

Dampness, rot and infestation	
<b>Repair category:</b>	1
<b>Notes</b>	There is no evidence indicating any significant dampness, rot or infestation within the limitations and scope of the inspection and report.

Chimney stacks	
<b>Repair category:</b>	1
<b>Notes</b>	There are no obvious issues noted.

Roofing including roof space	
<b>Repair category:</b>	1
<b>Notes</b>	The roof is generally in acceptable condition given its age and type of construction. general weathering has taken place and there is some excess moss growth visible on the rear roof slope.

Rainwater fittings	
<b>Repair category:</b>	2
<b>Notes</b>	<p>The plastic fittings are generally in acceptable condition although we note that gutters at the front and rear are choked in places by vegetation growth and should be cleared out.</p> <p>Cast-iron fittings are affected by rust staining in places and paintwork is generally weathered.</p>

Main walls	
<b>Repair category:</b>	1
<b>Notes</b>	<p>The outer walls are affected by general weathering consistent with what would be expected of a building of this age. There are also some relatively minor hairline cracks visible, indicating that the property has suffered from historic structural movement.</p>

Windows, external doors and joinery	
<b>Repair category:</b>	2
<b>Notes</b>	<p>The windows appear to be of some age. The sealed units generally have failed seals and condensation or misting has formed internally within the sealed panels. It is also noted that the internal silicone sealant around the uPVC frame is peeling off in places and should be replaced.</p> <p>The outer doors and timber soffits/fascias have a weathered appearance and would benefit from being repainted.</p>

External decorations	
<b>Repair category:</b>	2
<b>Notes</b>	<p>External decorations are generally weathered/worn and would benefit from being overhauled.</p>

Conservatories / porches	
<b>Repair category:</b>	
<b>Notes</b>	Not Applicable

Communal areas	
Repair category:	1
Notes	<p>The common close has generally been adequately maintained although there are some cosmetic and minor plaster repairs required.</p> <p>The timber frame to the window pertaining to the common close is weathered and requires to be overhauled.</p>

Garages and permanent outbuildings	
Repair category:	
Notes	Not Applicable

Outside areas and boundaries	
Repair category:	1
Notes	The garden areas have been adequately maintained, but are suffering to some extent from recent winter weather conditions.

Ceilings	
Repair category:	2
Notes	The ceiling in the living room has been overlaid with decorative polystyrene tiles. This is considered hazardous in the event of a fire and normal recommendations would be to have them removed.

Internal walls	
Repair category:	1
Notes	<p>No obvious defects to report.</p> <p>We would however, point out that there are several surface mounted pipes and conduits attached to the walls and ceiling in the kitchen. These have a somewhat unsightly appearance.</p>

Floors including sub floors	
Repair category:	1
Notes	There are no obvious issues to report. The floors are noted to be level and even throughout.

## Internal joinery and kitchen fittings

<b>Repair category:</b>	1
<b>Notes</b>	<p>There are no obvious defects noted to be affecting internal joinery fittings.</p> <p>Kitchen fittings are of an older style. They appear to have been reasonably well maintained but typical wear and tear has taken place.</p>

## Chimney breast and fire places

<b>Repair category:</b>	1
<b>Notes</b>	<p>It is assumed that the gas fire has been installed in accordance with the manufacturer's recommendations for fluing and ventilation and that this has been regularly checked and tested. All test documentation should be obtained and authenticated at the point of sale. In the absence of any such documentation, the appliance should be tested by a registered engineer prior to use.</p> <p>The gas fire was not tested. A limited surface visual inspection found no reportable items of disrepair. It should be verified that the gas fire has been checked and approved by a Gas Safe engineer within the previous 12 months and has been regularly serviced.</p> <p>The gas fire is of an older style and we would point out that we have not attempted to turn it on as this is outside the scope of our inspection.</p>

## Internal decorations

<b>Repair category:</b>	1
<b>Notes</b>	<p>Internal decorations have a slightly worn appearance in places, but have been adequately maintained.</p>

## Cellars

<b>Repair category:</b>	
<b>Notes</b>	Not Applicable

Electricity	
<b>Repair category:</b>	1
<b>Notes</b>	<p>It should be noted that the electrical installation has not been tested as this is outside the remit of this inspection.</p> <p>It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC / SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.</p>

Gas	
<b>Repair category:</b>	1
<b>Notes</b>	<p>There has been no test of the gas installation as this is not in our remit for this type of inspection.</p> <p>In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.</p> <p>It should be verified that the gas systems have been checked by a Gas Safe engineer within the previous 12 months.</p> <p>Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.</p>

Water, plumbing and bathroom fittings	
<b>Repair category:</b>	1
<b>Notes</b>	<p>There are no obvious defects affecting the visible plumbing apparatus.</p> <p>There are no obvious reportable defects affecting sanitary ware.</p>

## Heating and hot water

<b>Repair category:</b>	1
<b>Notes</b>	<p>The central heating system has not been tested as this is outside the scope of this inspection.</p> <p>It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.</p> <p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p>

## Drainage

<b>Repair category:</b>	1
<b>Notes</b>	<p>There are no obvious defects affecting the foul or surface water drainage systems.</p>

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	2
External decorations	2
Conservatories / porches	
Communal areas	1
Garages and permanent outbuildings	
Outside areas and boundaries	1
Ceilings	2
Internal walls	1
Floors including sub floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Category 1

1

No immediate action or repair is needed.

## Category 2

2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 3

3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

## 3. ACCESSIBILITY INFORMATION

### Guidance Notes on Accessibility Information

#### Three steps or fewer to a main entrance door of the property

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

#### Unrestricted parking within 25 metres

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	Yes
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

## 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

<b>Matters for a solicitor or licensed conveyancer</b>
<p>It is assumed that a Property Enquiry Certificate will be exhibited and that the property has a clear Title.</p> <p>The Solicitor/Conveyancer must ensure that any prospective purchaser fully understands the nature, criteria and basis of a Home Report and in particular what a Home Report is and what it is not (an exhaustive Condition Report) This should be done before any prospective purchaser makes an offer for this property based on the content of this report. If the Solicitor or purchaser requires any clarification in relation to this they must contact the surveyor or familiarise themselves with the nature and criteria of this type of report.</p> <p>Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialists or contractors advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.</p> <p>It is assumed that the roads and footpaths bounding the property have been adopted and are maintained by the Local Authority.</p> <p>It is assumed that the property is held in "Absolute Ownership" and is unaffected by any onerous Title restrictions or burdens.</p>

<b>Estimated re-instatement cost (£) for insurance purposes</b>
£315,000. (Three Hundred and Fifteen Thousand pounds.)

<b>Valuation (£) and market comments</b>
<p>£185,000. (One Hundred and Eighty-Five Thousand pounds.)</p> <p>The market value shown reflects the current condition of the property. Prevailing market conditions in the local area have also been considered</p>

<b>Report author:</b>	Alan Hudson
<b>Company:</b>	Walker Fraser Steele
<b>Address:</b>	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
<b>Electronically Signed By:</b>	Alan Hudson
<b>Date of report:</b>	10/02/2026



# Mortgage Valuation

## Case Details

Seller name(s):	Mr N Khan		
Address line 1:	87 Dixon Avenue		
Address line 2:			
Address line 3:			
Town / City:	Glasgow	County:	
Postcode:	G42 8EP		
Date of inspection (dd/mm/yyyy):	10/02/2026		

## Property Details

Property type:	Flat
Property style:	Purpose Built
Was the property built for the public sector?	Yes

### Specific details for: flats & maisonettes

Floor of property:	G	Number of floors in block:	2	Number of units in block:	4	Lift available in block?	No
--------------------	---	----------------------------	---	---------------------------	---	--------------------------	----

## Tenure

Tenure:	Absolute Ownership
---------	--------------------

### If Leasehold:

Unexpired term (years):		Ground rent (pa):	£
-------------------------	--	-------------------	---

## Accommodation

No. of living room(s):	1	No. of bedroom(s):	2	No. of kitchen(s):	1
No. of bathroom(s):	1	No. of WC(s):	0	No. of other room(s):	0
Description of other room(s):					
Floor area (m <sup>2</sup> ):	75	Floor area type:	External		

## Garages & Outbuildings

Garages / Parking space(s):	None.
Permanent outbuildings:	None.

## Construction

Wall construction:	Cavity brick with a sandstone facing to the front elevation.
Roof construction:	Pitched tile
Approximate year of construction:	1930
Any evidence of alterations or extensions?	No
Alterations or extension details:	

## Risks

Is there any evidence of movement to the property?	Yes
If yes, does this appear longstanding?	Yes
Are there any further risk factors?	No
If yes, please provide details:	Evidence of movement was noted in the form of cracking to masonry. This is believed to be longstanding and non-progressive.

## Services

Electricity:	Mains	Gas:	Mains	Water:	Mains
Central heating:	Full	Drainage:	Mains		
Provide comments:					

## Legal Matters

Are there any apparent legal issues to be verified by the conveyancer?	Yes
If yes, please provide details:	Shared Drive/Access. The conveyancer should obtain details. Our valuation assumes that the property is not adversely affected.

## Location

Location details:	The property is situated within a mainly residential area with an average level of local amenities.
-------------------	---

## Roads

Road description:	The road has been adopted.
-------------------	----------------------------

## General Remarks

The property comprises a purpose built flat on the ground floor of a two storey tenement block originally built by Glasgow City Council for tenant occupation.

The building is in acceptable condition for its age and type of construction. There are no issues that would have a negative impact on the suitability of the property for a mortgage.

None

 Mortgageability Remarks

The property is on a street with limited car parking availability.  
The market value shown reflects the current condition of the property. Prevailing market conditions in the local area have also been considered

 Valuation

Market value in present condition:	£ 185000
Market value after essential repairs:	£
Insurance reinstatement value:	£ 315000
Retention required? <input type="checkbox"/> No	Retention amount: £

 Declaration

Surveyor name:	Alan Hudson
Surveyor qualifications:	MRICS
Report date (dd/mm/yyyy):	10/02/2026
Company name:	Walker Fraser Steele
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
Telephone number:	01412210442
Email address:	Enquiries@walkerfrasersteele.co.uk
Surveyor signature:	



# Property Questionnaire

# Property Questionnaire

<b>Property address</b>	FLAT 0/1, 87 DIXON AVENUE, GLASGOW, G42 8EP
-------------------------	--

<b>Seller(s)</b>	Nageen Sattar Khan
------------------	--------------------

<b>Completion date of property questionnaire</b>	12 Feb 2026
--	-------------

# Property Questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

1.	<b>Length of ownership</b>	
	How long have you owned the property?	28 September 2023
2.	<b>Council tax</b>	
	Which Council Tax band is your property in? (Please circle)	
	A <b>B</b> C    D    E    F    G    H	
3.	<b>Parking</b>	
	What are the arrangements for parking at your property? (Please tick all that apply)	
	<ul style="list-style-type: none"><li>• Garage <input type="checkbox"/></li><li>• Allocated parking space <input type="checkbox"/></li><li>• Driveway <input type="checkbox"/></li><li>• Shared parking <input type="checkbox"/></li><li>• On street <input checked="" type="checkbox"/></li><li>• Resident permit <input type="checkbox"/></li><li>• Metered parking <input type="checkbox"/></li><li>• Other (please specify): <input type="text"/></li></ul>	
4.	<b>Conservation area</b>	
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<del>Yes / No /</del> <b>Don't know</b>

# Property Questionnaire

<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<b>Yes / No</b>
<b>6.</b>	<b>Alterations/additions/extensions</b>	
<b>a.</b>	<p>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</p> <p><u>If you have answered yes</u>, please describe below the changes which you have made:</p>	<b>Yes / No</b>
	<p>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</p> <p><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</p> <p>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</p>	<b>Yes / No</b>
<b>b.</b>	<p>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</p> <p><u>If you have answered yes</u>, please answer the three questions below:</p>	<b>Yes / No</b>
	(i) Were the replacements the same shape and type as the ones you replaced?	<b>Yes / No</b>
	(ii) Did this work involve any changes to the window or door openings?	<b>Yes / No</b>
	<p>(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):</p> <p>Please give any guarantees which you received for this work to your solicitor or estate agent.</p>	

# Property Questionnaire

<b>7. Central heating</b>		
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>gas-fired</p> <p>If you have answered yes, please answer the three questions below:</p>	Yes / <del>No</del> / <del>Partial</del>
b.	When was your central heating system or partial central heating system installed?	The central heating system has been there always
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p>If you have answered yes, please give details of the company with which you have a maintenance contract:</p>	<del>Yes</del> / No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
<b>8. Energy Performance Certificate</b>		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / <del>No</del>
<b>9. Issues that may have affected your property</b>		
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered yes, is the damage the subject of any outstanding insurance claim?</p>	<p><del>Yes</del> / No</p> <p><del>Yes</del> / <del>No</del></p>
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered yes, please give details:</p>	<del>Yes</del> / No

# Property Questionnaire

10.	Services																									
a.	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1" data-bbox="309 383 1374 1077"> <thead> <tr> <th data-bbox="309 383 651 443">Services</th> <th data-bbox="651 383 879 443">Connected</th> <th data-bbox="879 383 1374 443">Supplier</th> </tr> </thead> <tbody> <tr> <td data-bbox="309 443 651 535">Gas / liquid petroleum gas</td> <td data-bbox="651 443 879 535" style="text-align: center;">✓</td> <td data-bbox="879 443 1374 535">British Gas</td> </tr> <tr> <td data-bbox="309 535 651 624">Water mains / private water supply</td> <td data-bbox="651 535 879 624" style="text-align: center;">✓</td> <td data-bbox="879 535 1374 624">Scottish Power</td> </tr> <tr> <td data-bbox="309 624 651 714">Electricity</td> <td data-bbox="651 624 879 714" style="text-align: center;">✓</td> <td data-bbox="879 624 1374 714">Scottish Power</td> </tr> <tr> <td data-bbox="309 714 651 804">Mains drainage</td> <td data-bbox="651 714 879 804"></td> <td data-bbox="879 714 1374 804"></td> </tr> <tr> <td data-bbox="309 804 651 893">Telephone</td> <td data-bbox="651 804 879 893" style="text-align: center;">✓</td> <td data-bbox="879 804 1374 893">We used to use BT</td> </tr> <tr> <td data-bbox="309 893 651 983">Cable TV / satellite</td> <td data-bbox="651 893 879 983" style="text-align: center;">✓</td> <td data-bbox="879 893 1374 983">We used to have BT Broadband</td> </tr> <tr> <td data-bbox="309 983 651 1077">Broadband</td> <td data-bbox="651 983 879 1077" style="text-align: center;">✓</td> <td data-bbox="879 983 1374 1077">We used to use BT Broadbank</td> </tr> </tbody> </table>		Services	Connected	Supplier	Gas / liquid petroleum gas	✓	British Gas	Water mains / private water supply	✓	Scottish Power	Electricity	✓	Scottish Power	Mains drainage			Telephone	✓	We used to use BT	Cable TV / satellite	✓	We used to have BT Broadband	Broadband	✓	We used to use BT Broadbank
Services	Connected	Supplier																								
Gas / liquid petroleum gas	✓	British Gas																								
Water mains / private water supply	✓	Scottish Power																								
Electricity	✓	Scottish Power																								
Mains drainage																										
Telephone	✓	We used to use BT																								
Cable TV / satellite	✓	We used to have BT Broadband																								
Broadband	✓	We used to use BT Broadbank																								
b.	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes</u>, please answer the two questions below:</p>	<b>Yes / No</b>																								
c.	(i) Do you have appropriate consents for the discharge from your septic tank?	<b>Yes / No / Don't know</b>																								
d.	<p>(ii) Do you have a maintenance contract for your septic tank?</p> <p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>	<b>Yes / No</b>																								

# Property Questionnaire

<b>11.</b>	<b>Responsibilities for Shared or Common Areas</b>	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No / <del>Don't Know</del>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p> <p>Through property management company Lowther</p>	Yes / <del>No</del> / <del>Not applicable</del>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<del>Yes</del> / No
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> <p>Rubbish bins are out in the back garden for all neighbours to have access</p>	Yes / <del>No</del>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p> <p>same as above</p>	Yes / <del>No</del>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes</del> / No
<b>12.</b>	<b>Charges associated with your property</b>	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p> <p>Lowther Wheatley House 25 Cochrane Street Glasgow G1 1HL</p>	Yes / <del>No</del>

# Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p>Yes / No / Don't Know</p> <p>Yes / No / Don't Know</p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<p><b>13. Specialist works</b></p>		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p>Yes / No</p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p>Yes / No</p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p>Yes / No</p>

# Property Questionnaire

<b>14.</b>	<b>Guarantees</b>						
<b>a.</b>	<b>Are there any guarantees or warranties for any of the following:</b>						
<b>(i)</b>	<b>Electrical work</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(ii)</b>	<b>Roofing</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(iii)</b>	<b>Central heating</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(iv)</b>	<b>NHBC</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(v)</b>	<b>Damp course</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>(vi)</b>	<b>Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)</b>	<b>No</b>	<b>Yes</b>	<b>Don't know</b>	<b>With title deeds</b>	<b>Lost</b>	<b>Cannot Answer*</b>
<b>b.</b>	<b>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b>						
<b>c.</b>	<b>Are there any outstanding claims under any of the guarantees listed above?</b> <b>If you have answered yes, please give details:</b>					<b>Yes / No</b>	
<b>15.</b>	<b>Boundaries</b>						
	<b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b> <b>If you have answered yes, please give details:</b>					<b>Yes / No / Don't know</b>	

# Property Questionnaire

<b>16.</b>	<b>Notices that affect your property</b>	
	<b>In the past 3 years have you ever received a notice:</b>	
<b>a.</b>	<b>advising that the owner of a neighbouring property has made a planning application?</b>	<b>Yes / No / Don't know</b>
<b>b.</b>	<b>that affects your property in some other way?</b>	<b>Yes / No / Don't know</b>
<b>c.</b>	<b>that requires you to do any maintenance, repairs or improvements to your property?</b>	<b>Yes / No / Don't know</b>
	<b>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</b>	

**Declaration by the seller(s)/or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

**Signature(s):** \_\_\_\_\_

\_\_\_\_\_

**Date:** \_\_\_\_\_

\_\_\_\_\_





# Walker Fraser Steele Chartered Surveyors

For further information, please  
call 0141 221 0442 or email  
[enquiries@walkerfrasersteele.co.uk](mailto:enquiries@walkerfrasersteele.co.uk)

Walker Fraser Steele  
First Floor  
Suite 1/3 Cadell House  
27 Waterloo Street  
Glasgow  
G2 6BZ